



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SERVICE INDICATIONS: On 200 Selection Phonographs only, failure of Contacts 7 and 11 of Ry-3, and periodically require cleaning or burnishing.

SUBJECT: The addition of a resistor in the circuit of Ry-4 is required.

Parts needed:

- 1 - 50 ohm 5 watt resistor.
- 1 - One lug insulated terminal strip.
- 1 - Screw, nut and lock washer to mount terminal strip.

MODIFICATION:

Remove Junction Box from phonograph. Remove bottom plate of Junction Box. Install a one lug insulated terminal strip (the mounting hole is available in the rear plate).

Locate Ry-4 Pin #13. Unsolder the negative lead of the 100 mfd. capacitor and remove from Pin #13 of Ry-4. Install lead just removed onto new added terminal lug. Do not solder. Solder one lead of the 50 ohm 5 watt resistor to Pin #13 of Ry-4. Install the other end of this resistor on the same terminal lug along with the lead of the capacitor which was just previously installed. Solder both leads.

Install bottom plate, junction box and check for operation.

NOTE: This change may be readily determined on a given phonograph without removing Junction Box as follows:

End plate of Junction Box Assembly (as viewed visually from back of phonograph) will have rivet or screw head showing, indicating addition of terminal strip.

All machines shipped after June 18, 1964 have this modification.

It is suggested all 2800 200 Selection Phonographs you have in stock be modified as to this Service Slant.