



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SERVICE INDICATION: On 2810-4 only. Incorrect amount of credits established on playrak when trying to cheat machine, by holding down one of the L. P. Letter Keys and at the same time depositing a quarter or half dollar.

If a complaint of this nature is received a wiring change should be made on the keyboard.

MODIFICATION:

1. Unsolder and move the Purple Wire with Yellow Tracer from Row 5 to Row 3 of the left hand side of the letter switch and solder.
2. Unsolder Light Green Wire from Row 3 of the right hand side of the letter switch.
3. Unsolder and remove Brown Wire from Row 5 on the right hand side of the letter switch.
4. Solder Brown Wire which was just removed from Row 5 to Row 3.
5. Remove Light Tan Wire from Contact 3 of the Pre-Set Solenoid Latch Switch.
6. Solder Light Tan Wire which was just removed from the Pre-Set Solenoid Latch Switch to Row 5 on the right hand side of the letter switch.
7. Solder Light Green Wire to Contact 3 of the Pre-Set Solenoid Latch Switch.

NOTE: The above modification has been complied with on all 2810's manufactured after Serial No. 606319.