



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: All Model 3400, 3410 and 3460 Phonographs shipped from factory prior to the following serial numbers:

<u>Model</u>	<u>Serial Number</u>
3400	734832
3410	744640
3460	748625

COMPLAINT: Audible popping or clicking through speakers of Phonograph when making selections.

CORRECTIVE ACTION: To correct the above mentioned condition, perform the following...

1. Connect a 0.1 MFD., 400V Capacitor across the Counter (Circuit 44 to 32).
2. Solder Capacitor connections securely.

All Model 3400, 3410 and 3460 Phonographs shipped from factory after the above Serial Number listing will not require this added Capacitor.