

WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"

ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEP'T., NORTH TONAWANDA, N. Y

SUBJECT:

Safety switch adjustment change on all 3400 Series Statesman

Phonographs.

REASON:

Provides a greater safety margin between record and takeout arm

record clamp.

New Safety Switch Adjustment Procedure

With phonograph in rest position, manually bottom safety switch actuator against the switch body. Adjust and set safety switch to provide 1/32" clearance between record takeout arm clamp roll pln and switch actuator.

Check and Adjust Procedure for Checking Safety Switch Setting.

With the machine at rest and the record clamp lever fully returned by the cam, the safety switch should be made with 1/64" to 1/32" clearance between the switch actuator to the switch body. Manually operate the shaft that moves the record clamp lever until the safety switch deactivitates. At this position there should be clearance between the record clamp lever and the records in the magazine.

Phonographs shipped after 11/21/69 have the new safety switch setting.