



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEP'T., NORTH TONAWANDA, N. Y.

SUBJECT: Revised Record Clamp Arm Release Stop Screw Setting.

REVISED ADJUSTMENT: With Part No. 135551 (6.812") disc, clamp in Record Takeout Arm, the arm just starting to lift, there should be $3/64$ " to $5/64$ " clearance between roll pin and record clamp release arm. Position adjusting screw on top of gear box if necessary. Lock nut securely and add Loctite.

All Wurlamatic mechanisms manufactured on or after December 3, 1969 have been adjusted to meet the above revision requirements.

3400 Series Phonographs already in the field and operating will not be immediately affected by this Service Slant. However, if readjustment of record clamp arm release stop screw is ever required on machines manufactured either prior to or after December 3, 1969, readjust according to the adjustment procedure of this Service Slant.