



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Revised Back Stop Pawl Adjustment on the 3400 Series Wurlamatic Changer.

AFFECTING: 3400 Series Service Manual RECORD CHANGER ADJUSTMENT Section C, Page 6C and BACK STOP PAWL ADJUSTMENT Paragraphs A through C.

REVISED ADJUSTMENT: Adjust the back stop pawl for 1/16" to 1/8" engagement, radially, with a locking tooth and 1/16" to 3/32" circumferential clearance to the tooth.

All Wurlamatic mechanisms manufactured on or after December 17, 1969 have been adjusted to meet the above revision requirements.

3400 Series Phonographs already in the field and operating will not be immediately affected by this Service Slant. However, if readjustment of back stop pawl is ever required on machines manufactured either prior to or after December 17, 1969, readjust according to the adjustment procedure of this Service Slant.