



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Revised Readout Arm Adjustment.

AFFECTING: 3400 Series Service Manual RECORD CHANGER ADJUSTMENTS
Section C, Page 7C SIDE 1 CANCEL SOLENOID ADJUSTMENT,
Paragraphs A through E.

REVISED ADJUSTMENT: Position the magazine to play A-3 - adjust the screw
separating the readout arm and the support arm so the
cancel plungers are centered within + or - 1/64" over
pins. (Check 90° 4 places) - see check points.

<u>100</u>	<u>160</u>	<u>200</u>
A-3-4	C-D-1	A-3-4
F-3-4	C-D-6	L-3-4
E-9-0	M-N-3	F-3-4
K-9-0	M-N-8	R-3-4

NOTE: This adjustment must not be made until the
location of the magazine lock assembly is determined.
If the location of the magazine lock assembly is ever
revised the readout arm must be readjusted.

All Wurlamatic mechanisms manufactured on or after December 17, 1969 have
been adjusted to meet the above revision requirements.

3400 Series Phonographs already in the field and operating will not be immed-
iately affected by this Service Slant. However, if readjustment of readout
arm is ever required on machines manufactured either prior to or after
December 17, 1969, readjust according to the adjustment procedure of this
Service Slant.