



# WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

**SUBJECT:** Wiring Change, Top Tunes Unit.

**AFFECTING:** Wurlitzer Statesman 3400 and 3460 Phonographs with Top Tunes manufactured prior to January 9, 1970.

**COMPLAINT:** Top Tune credit established by depositing one quarter.

**CAUSE:** Playrak Cancel Wheel overtravel bounces Top Tune switch.

**CORRECTION  
MODEL 3400:**

1. Remove Junction Box from floor of Phonograph.
2. Remove cover from Top Tune Unit, mounted on Junction Box.
3. Cut #19 wire (White-Purple) at pin 15 of 30 pin plug.
4. Connect, solder and tape the #19 wire to the #28 wire (Gray-Red). The #28 wire connects pin 27 of the 30 pin plug to pin 1 of the 9 pin socket.

**CORRECTION  
MODEL 3460:**

1. Remove Junction Box from floor of Phonograph.
2. Remove cover from Top Tune Unit, mounted on Junction Box.
3. Cut #20 wire (Black-Purple) at pin 29 of 30 pin plug.
4. Connect, solder and tape the #20 wire to the #28 wire (Gray-Red). The #28 wire connects pin 27 of the 30 pin plug to pin 1 of the 9 pin socket.

FLIPPERS.COM