



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEP'T., NORTH TONAWANDA, N. Y.

SUBJECT: Lubrication of bail spring and sleeve.

AFFECTING: All Model 3400, 3410 and 3460 Phonographs manufactured and shipped prior to February 9, 1970.

PROCEDURE: To lubricate the bail spring and sleeve, place phonograph in rest position and apply a sufficient amount of Dow Corning Grease Compound #33 between and around all turns of spring.

For identification of the above see 3400 Series Service Manual Page 29C, Item 8 (Sleeve, Part No. 132671) and Item 13 (Spring, Part No. 128533).

If for any reason this spring should ever be removed or changed, it is suggested a visual inspection of the sleeve be made. If any galling or cutting of the sleeve is apparent, sleeve should be replaced.

After replacing spring and with record changer in rest position a check should be made as to the proper spring turns. Counting across the top of the total spring coil and excluding the hook ends, 12 turns of the spring should be visible and 12 turns counted.

All phonographs manufactured and shipped after February 9, 1970 have lubricated springs and sleeves. All phonographs prior to this date and in the field should be lubricated as per this service slant.

The lubrication is Dow Corning Grease Compound #33 and may be ordered from The Wurlitzer Company Parts Department under Part No. 68684B (4 oz. Jar).