



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N.Y.

SUBJECT: New procedure for Side 1 and Side 2 Readout Switch Actuator Pretravel Adjustment.

EFFECTIVITY: All 3400 Series Phonographs manufactured after the following serial numbers:

Model	Serial Number
3400	736494
3410	745209
3460	748879

PROCEDURE: To adjust Actuator pretravel on the Side 1 and Side 2 Readout Switches perform the following:

1. Turn Phonograph Volume Control fully counterclockwise.
2. Select A-2.
3. With selected record in play position, turn SIDE 2 PRETRAVEL ADJUSTMENT SCREW clockwise until SIDE 2 RELAY activates (listen for audible click of relay). Refer to Figure 1.

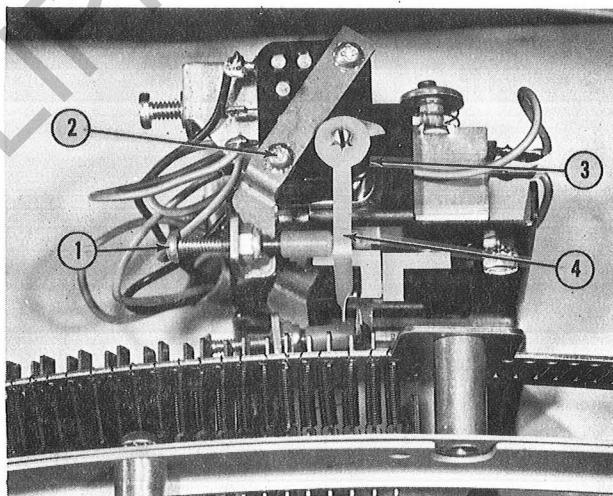


Figure 1. Readout Switch Actuator Pretravel Adjustment

- | | | | |
|---|---------|--|--------|
| 1. Pretravel Adjustment Screw,
Side 2 | | 3. Switch and Actuator Lever
Assembly, Side 2 | 135803 |
| 2. Pretravel Bracket and Stop
Nut Assembly | 135499 | Switch and Actuator Lever
Assembly, Side 1 | 135802 |
| Screw, 4-40 x 3/4 Sems P.H. | 73533-8 | 4. Readout Switch Actuator | |
| Actuator, Readout Switch | 135748 | | |

4. Turn SIDE 2 PRETRAVEL ADJUSTMENT SCREW slowly counterclockwise until SIDE 2 RELAY deactivates (listen for audible click of relay), then turn screw one additional full turn counterclockwise .
5. Select A-3.
6. With selected record in play position, turn SIDE 1 PRETRAVEL ADJUSTMENT SCREW clockwise until SIDE 1 RELAY activates (listen for audible click of relay). Refer to Figure 1.
7. Turn SIDE 1 PRETRAVEL ADJUSTMENT SCREW slowly counterclockwise until SIDE 1 RELAY deactivates (listen for audible click of relay), then turn screw one additional full turn counterclockwise .
8. Verify that SIDE 1 and SIDE 2 READOUT SWITCH ACTUATORS do not come to rest over LATCH PIN.
9. Turn Phonograph Volume Control to desired audio level.

FLIPPERS.COM