



# WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

**SUBJECT:** All -4 and -7 3500, 3510 and 3560 Series Phonographs, equipped with Four Quarter Credit Accumulator, shipped from the Factory prior to the following Serial Numbers:

3500 - 761900  
3510 - 770862  
3560 - 774706

**COMPLAINT:** With one dollars worth of credit established on Four Quarter Credit Accumulator, a loss of credits may occur when making L.P. selections.

**CAUSE:** Premature release of Dollar Relay RY-44 when making second L.P. selection.

**REASON FOR CHANGE:** To provide full cycle ground to Dollar Relay RY-44 to prevent premature release of Dollar Relay RY-44.

#### NOTE

Some Phonographs, equipped with the Four Quarter Credit Accumulator, shipped prior to the above quoted Serial Numbers, have this wiring change incorporated. However it is recommended that all Junction Boxes be checked and this change be incorporated, whether or not the above complaint is apparent, to preclude the possibility of said complaint developing.

**PROCEDURE:** To incorporate the required wiring change, on -4 Phonographs, perform Steps 1 and 2. To incorporate required wiring change on -7 Phonographs, perform Steps 1 and 3.

1. Remove Purple wire from Pin 3 of Relay RY-12.
2. Connect and solder Purple wire, removed in Step 1, to Red/Green wire on Pin 4 of Relay RY-11.
3. Connect and solder Purple wire removed in Step 1 to Red/Black wire on Pin 10 of Relay RY-26.

Model 3500, 3510 and 3560 (-4's and -7's) Phonographs shipped from the factory after Serial Numbers listed under SUBJECT will have this wiring change incorporated.