



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Wurlitzer Model 551 Amplifier .

COMPLAINT: The 1.25 Amp. Fuses, protecting A and B Channels, opening for no apparent reason .

CAUSE: The 1.25 Fuse, Part No. 71591-13, protecting A and B Channels, located on the Model 551 Amplifier Fuse Block, opening due to isolated instances of thermal and/or ambient temperature increase .

REASON FOR CHANGE: To preclude the possibility of fuse opening on existing or future equipment .

Materials Required

4 - 71591-16 Fuse, 1.6 Amp., Slo Blo
(Buss, 1.6 Amp., Slo Blo)

CHANGE: If Fuses are found to be open, it is suggested that the four 1.25 Fuses in Model 551 Amplifier be replaced with Fuses listed under Materials Required .

NOTE

All Model 3500 Series Phonographs shipped from the factory after Serial Numbers listed below will have this change incorporated .

Model	Serial No.
3500	763492
3510	771368
3560	774924