



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Transfer Switch, Part No. 128344, on Model 3500 Series Phonographs.

COMPLAINT: Intermittent operation of Transfer Switch.

CAUSE: Excessive Silicone grease used to lubricate the Track Cam of the Cam and Gear Assembly building up on Transfer Switch and seeping into switch body.

CORRECTION: If the above complaint is occurring, perform the following:

1. Remove Transfer Switch.
2. Wipe Silicone grease from Track Cam.
3. Install new Transfer Switch.
4. Adjust Transfer Switch in accordance with TRANSFER SWITCH ADJUSTMENT, Page 12 C, 3500 Series Service Manual.