


WURLITZER SERVICE SLANT

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

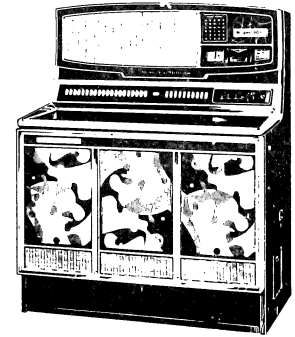

WURLITZER SERVICE DEPARTMENT • NORTH TONAWANDA, NEW YORK

SUBJECT:

Wurlitzer Model C-110 Cassette

COMPLAINT:

Insufficient engagement of some Cassette Tapes on Tape Deck Turntable causing cancellation when Cassette Tape is placed in "Play" position.

CORRECTIVE ACTION:

Installation of a Retaining Ring (used as a spacer) to provide additional pressure on the Turntable Springs.

NOTE

This modification has been incorporated on some Model C-110 Cassette Tape Players recently shipped from the factory.

Material Required

4 - 0019030006 Retaining Ring

To correct the above complaint, perform the following:

1. Position one RETAINING RING, Part No. 0019030006, on each TURNTABLE as shown in Figure 1.
2. Lift SPRING sufficiently to provide clearance between TURNTABLE and SPRING, then install RETAINING RING on TURNTABLE SHAFT as shown in Figure 2.
3. Repeat Steps 1 and 2 for opposite Tape Deck.

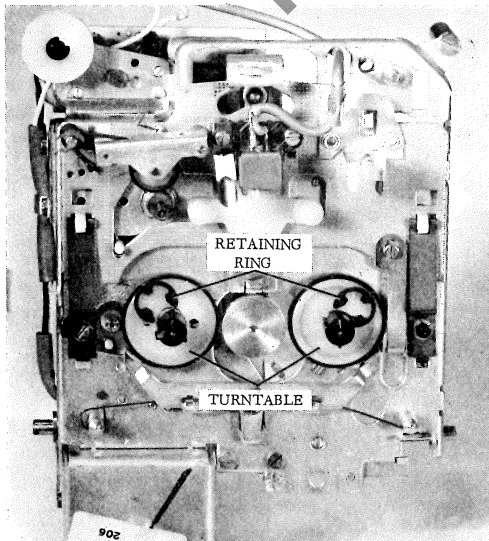


Figure 1

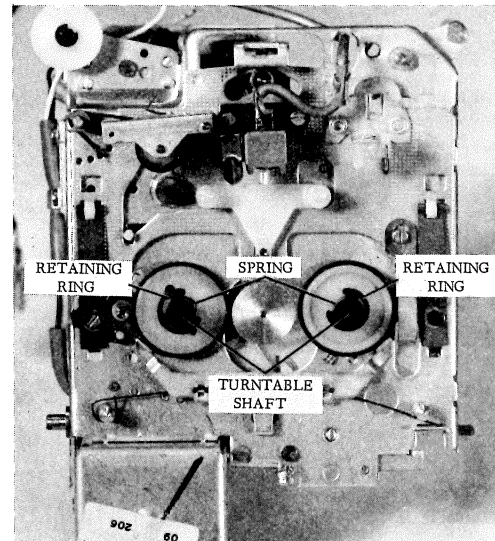


Figure 2

ESTABLISHED
1856

THE WURLITZER COMPANY

NORTH TONAWANDA, NEW YORK 14120

NORTH
TONAWANDA
DIVISION

August 29, 1972

Mr. Dale M. Johnson
Dale Distributing (B.C.) Ltd.
563 Minoru Boulevard
Richmond, B.C., Canada

Dear Dale:

We are enclosing thirty-six Part No. 0019030006 Retaining Rings to be installed four to a unit as per enclosed service slant.

We have shipped you a total of nine Carousels and the enclosed rings will cover the equipment you have purchased.

Sincerely

THE WURLITZER COMPANY



C. B. Ross
Service Manager

CBR:AH
ENC. 7

FLIPPERS.COM