



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME


ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

November 3, 1947

TO ALL DISTRIBUTORS:

SUBJECT: Failure of Fuses in Model 2140 Bar Box Installations

Blown fuses in the Model 212 Master Unit are most commonly caused by the bracket which holds the program window inside the cover of the Bar Box, which touches the solder lug of the left hand light socket when the Bar Box cover is closed. Remedy is to remove the bracket, and file out a small clearance space where the short occurs. In some cases it may be necessary to bend down the lug on the socket as well, after the bracket has been filed and replaced.

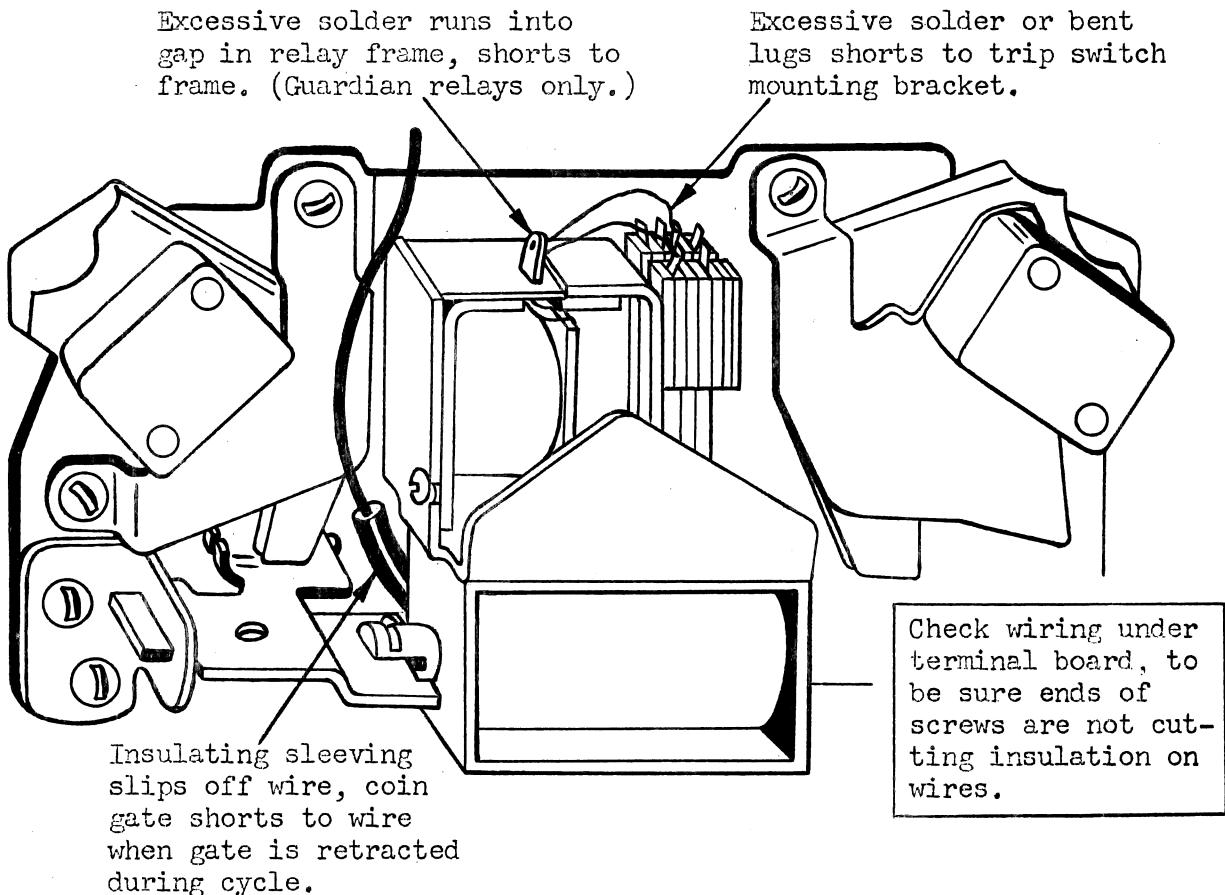

After clearing, all relay contacts in Bar Boxes and Master Unit should be cleaned to compensate for excessive arcing due to above conditions. These items are being carefully checked in all present and future production.