



# SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

## Installation of Back Stop Pawl

Where it is found desirable to replace #57651 Lever and Pin Assembly with #57890 Pawl and Hub Assembly, this may be accomplished by drilling one hole in the Channel and Bracket Support Assembly.

Drill hole .171" diameter (or #17 drill) on center line. This locates  $3/8$ " below and  $3/32$ " toward selector shaft from center of the hole used in mounting first back stop pawl. We are supplying a template to locate drilling point.

Remove old pawl. For convenience also remove the bracket and rubber bumper which will be used again after drilling hole.

Mount #57890 Pawl and Hub Assembly as indicated in sketch below. A Spring, #58400, is mounted with small section next to the pawl as indicated.

Counter-bore a recess  $1/4$ " deep in cabinet back door assembly to afford good clearance for shoulder screw.

