



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS" ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

MODELS 1500, 1550, 1500A, AND 1550A TURN-TABLE MOTOR REPLACEMENT.

1. Turn-table motors used on later models 1500A and 1550A are of the optional type (Part No. 56455). Due to the fact that the earlier motors (Part No. 56454) are no longer available, any orders received for turn-table motors will be filled with Part No. 56455.
2. For this later motor to mount accurately in the mounting casting (Part No. 56874), it will be necessary to delete parts marked in Fig. 1 and in their place use the following parts:

4-49153	Connector
2-56843	Shock Mount
8-73691-34	Screw, Sem 8-32 x $\frac{1}{4}$ "
6-73607-5	Lock Washer
6-73601-6	Nut -6-32 Hex

3. The assembly will be accomplished as shown in Fig. 2
4. The parts designated in paragraph 2 will automatically be included with Part 56455 Turn-table Motor when designated for a Model 1500 or 1550, 1500A or 1550A phonograph. This practice will continue until otherwise instructed by the distributor.
5. Part No. 54439-1 Bearing, upper is now available for replacement of turn-table motor (Part No. 56454) upper bearings, and Part No. 54439-2 bearing, lower is available for replacement of the lower bearing. These bearings may also be used on Models 1600 and 1400.

