



# SERVICE SLANTS


YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS" ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

## MODEL 1900

SUBJECT: To Tighten Driver Lever Mounting Stud.

1. In cases where a wrong letter selection is experienced it may be found that the "Mounting Stud" for the "Driver Lever of the Rotating Plate" has loosened. As shown in sketch below, this stud may be tightened from underneath the selector by using one 3/8" open end wrench to tighten and hold the stud and a second 3/8" open end wrench to tighten the lock nut.

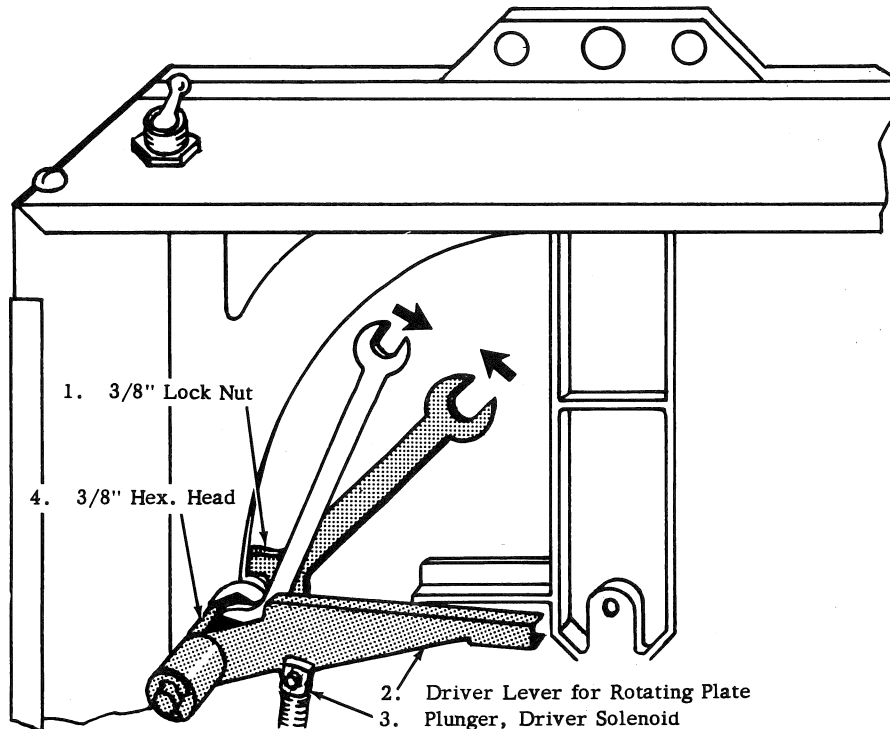

2. Also it is suggested that such Model 1900 Coin Register Mechanisms as are equipped with a 1/2 Amp. fuse be modified as follows:

Remove the wire that feeds the coil of the start relay from the end of the fuse holder that the cancel solenoid lead is connected to and connect it to the other end of the fuse holder, leaving only the cancel solenoid on the fused circuit.