



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Correction for Installation Instructions Part No. 114687
(Kit 154) Conversion of Model 2200 to Stereophonic
Operation With Model 534 Dual Channel Amplifier

It has been called to our attention of an error in the above subject instruction sheet on Page 3, Paragraph 5, Item E (mute and play switch connections). Item E should read as follows:

Remove the shielded wire from blade No. 2, the second blade from the left (as viewed from the rear) of the mute switch. Solder the shield of both shielded cables to blade No. 3. The center wire of the second shielded cable should be soldered to blade No. 2. Install and secure the cap of the plug.

Attach this slant to the above subject instruction sheet.