



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS" ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: 2600 Series Phonographs - rumble in music. Appears as a definite beat with each revolution of the record. More noticeable when playing at 33 1/3 R. P. M.

CAUSE: The frequency of some tones produced by certain records set up mechanical vibrations in turntable motor and mounting bracket.

CORRECTION: The Eccentric Washer, Part No. 122050, shown at Item 1 in the figure below, may be installed by removing the screw, Item 2. A longer replacement Screw, Part No. 36176, is furnished for installing the eccentric washer.

Insert the longer screw through the eccentric washer and install the screw through the motor laminations and into the motor mounting stud. Set the eccentric washer to bear firmly against the Shift Solenoid Mounting Bracket, Item 3. Hold the washer in this position and tighten the screw.

CAUTION: A microphonic condition may be produced if the eccentric washer is forced too tightly against the solenoid mounting bracket.

