



# SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

**SERVICE INDICATION:** Burning and freezing together of Contacts 5 and 9 of Ry-4 on the 100 and 200 Selection Phonographs.

Sometimes not cancelling off last credit if all three credit wheels were released by depositing 10, 25 and 50 cent coins before making any selection and then selecting.

**SUBJECT:** Playrak wiring modification and installation of a new resistor.

Resistor required: 1 - 10 ohm 10 watt or 1 - 25 ohm 5 watt.

**MODIFICATION:** Remove the playrak from the phonograph.

Locate the 3 lug terminal strip, 25 ohm 5 watt resistor and the 500 mfd. capacitor. Install a new 25 ohm 5 watt resistor in parallel with the present 25 ohm 5 watt or remove the 25 ohm 5 watt resistor and install a 10 ohm 10 watt resistor to the same terminals the 25 ohm was removed from. This choice will allow you to change 2 playraks with the aid of 1 - 10 ohm 10 watt resistor. Remove the black and green wires from the terminal strip. Transpose these wires, installing the green wire where the black was and the black where the green was previously located. Solder all connections at this time. The wire colors on the terminal strip should now be the red on your left, green in the center and black on the right.

Install the playrak in the phonograph and check for proper operation.

**NOTE:** This change may be readily determined by opening playrak and observing presence of 2 (25 ohm) resistors in parallel and the transposition of wires mentioned above.

All machines shipped after June 18, 1964 have this modification.

It is suggested all playraks of the 2800's and 2810's you have in stock should be modified as to this Service Slant.