



# SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SERVICE INDICATION: 2800-7 with Ten Top Tunes and L. P. Units only.  
Incorrect amount of credits established on playrak when trying to cheat machine by holding down one of the L. P. Letter Keys and at the same time depositing a quarter or half dollar.

If a complaint of this nature is received a wiring change should be made in the junction box of the 2800-7.

MODIFICATION:

1. Remove Junction Box from phonograph.
2. Remove the Jumper wire between Pins #11 and #12 of Ry-1. Move the Green wire with Black Tracer from Pin #12 to Pin #11 and solder, leaving Pin #12 free of all connections at this time.
3. Unsolder and remove the White wire with Purple Tracer from Pin #8 of the Special Programmer Socket.
4. Install the White wire with Purple Tracer, which was just removed in Item 3, to Ry-1 Pin #12 and solder.
5. Remove the Brown wire with White Tracer from Pin #9 of the Coin Mech. Socket.
6. Install this Brown wire with White Tracer, which was just removed in Item 5, on the Special Programmer Socket Pin #8 and solder.
7. Add a short 2 inch length of wire between Pin #5 and Pin #9 of the Coin Mech. Socket and solder both ends.

NOTE: The above modification has been complied with on all 2800's manufactured after Serial No. 600000 (Approximately).