



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Capacitor change in 550 Amplifiers to preclude high hiss and background noise created by certain records.

At the discretion of the distributor this change may be affected on all Model 3400, 3410 and 3460 Phonographs. Any Phonograph received after the following Serial Numbers will not require this change:

<u>MODEL</u>	<u>SERIAL NUMBER</u>
3400	734839
3410	744683
3460	748625

1. Remove Amplifier from Phonograph.
2. Remove Cover Assembly from Amplifier.
3. Unsolder and remove Capacitor C-11 (.0022 Mfd.) from both channels and replace removed Capacitors with .0047 Mfd. Capacitors, Part Number 76392-341. Solder connections securely.
4. Unsolder and remove Capacitor C-12 (.0022 Mfd.) from both channels and replace removed Capacitors with .0033 Mfd. Capacitors, Part Number 76396-341. Solder connections securely.
5. Install Cover Assembly on Amplifier.
6. Install Amplifier in Phonograph.

NOTE

All Phonographs are shipped from the factory with the 550 Amplifier TREBLE Switches in the full DECREASE position.