



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

All Statesman 3400 Series Phonographs shipped prior to 11/17/69.

SUBJECT: #1 - Removal of wire #25.
#2 - New clearance adjustment for main cam brake.

CORRECTION: #1 - Delete wire #25 (tan with blue tracer) between safety switch and record now playing coil and lamp plug.
#2 - Readjust main cam motor brake to new clearance. Main cam brake clearance should be set to a clearance of $1/32'' + 1/64'' - 0$, when energized.

REASONS FOR WIRE REMOVAL: To prevent damage to record magazine if main cam brake fails for any apparent reason.

All Statesman 3400 Series Phonographs shipped after the above date have these corrections.