



# WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEP'T., NORTH TONAWANDA, N. Y.

- SUBJECT:** Revised Play Switch Setting.
- AFFECTING:** 3400 Series Service Manual RECORD CHANGER ADJUSTMENT  
Section C, Page 19C and PLAY SWITCH ADJUSTMENT  
Paragraphs A and B.
- REVISED ADJUSTMENT:** The play switch actuating arm screw should be set with  
1/16" to 1/8" clearance to switch actuator at rest  
position. Check for the following under power:
1. If the changer does not stop at play position, the  
switch is operating too late and is coasting  
through.
  2. If, when the trip switch restarts, the motor and  
the changer stops and does not carry through the  
play switch is operating too early. Reset to make  
the switch operate later and check for Item #1  
again.

All Wurlamatic mechanisms manufactured on or after December 17, 1969 have  
been adjusted to meet the above revision requirements.

3400 Series Phonographs already in the field and operating will not be im-  
mediately affected by this Service Slant. However, if readjustment of play  
switch is ever required on machines manufactured either prior to or after  
December 17, 1969, readjust according to the adjustment procedure of this  
Service Slant.