



# WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

**SUBJECT:** Wurlitzer Model 551 Amplifier shipped from factory prior to the following Serial Numbers:

Model 3500 - 764007

Model 3560 - 774952

Model 3510 - 771409

**COMPLAINT:** Intermittant loss of bass and rise in treble.

**CAUSE:** Insulation on three wire cable from PHONO INPUT to Amplifier Printed Board wearing through due to vibration in transit. This permits the shield to short to terminal of SCRATCH COMPENSATOR ON-OFF Switch and/or terminal on Printed Board.

**CORRECTION:** If the above complaint is apparent redress and tape cable as required to provide proper insulation.

#### NOTE

Phonographs shipped from the factory after the Serial Numbers listed above have been rewired to preclude the possibility of this complaint.