



# WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS" ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEP'T., NORTH TONAWANDA, N. Y.

BRAD  
~~XXXXXXXXXX~~  
~~XXXXXXXXXX~~

**SUBJECT:**

All Wurlitzer Model 551 Amplifiers shipped from the factory after the following serial numbers: *HAVE CHANGE INCORPORATED.*

Model	Serial Number
3500	765385
3560	775143
3510	771726

**COMPLAINT:**

The 3 Amp. Slo-Blo Fuses opening when Phonograph is subjected to full loading at full volume.

**CAUSE:**

3 Amp. Fuses overloading.

**Materials Required**

2 - 71590-27	Fuse, 5 Amp.
2 - 72229-31	Resistor, 36K, 1/2 W, 5%

**CORRECTION:**

To correct the above complaint perform the following:

1. Replace the 3 Amp. Slo-Blo Fuses (F3 and F4) with new 5 Amp. Fuses, Part No. 71590-27.
2. Replace the 30K, 1/2 W, 5% Resistors (R-14) in each channel with new 36K, 1/2 W, 5% Resistors, Part No. 72229-31.

**NOTE**

All Phonographs shipped from the factory after the above listed Serial Numbers will have this change incorporated.

(10)