


WURLITZER SERVICE SLANT

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

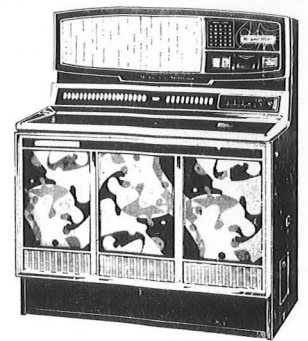

WURLITZER SERVICE DEPARTMENT • NORTH TONAWANDA, NEW YORK

SUBJECT:

Fluorescent lamp wiring on all Model 3600, 3660 and 3610 Phonographs shipped from the factory prior to the following serial numbers:

Model	Serial Number
3600	776295
3660	789700
3610	785770

COMPLAINT:

Fluorescent lamp wires being pinched by cable clamps causing separation of insulation.

CORRECTIVE ACTION:

Inspect the areas shown in Figures 1 through 4 and verify that wires are not pinched by CABLE CLAMPS. If wires are pinched, perform the following:

- Loosen CABLE CLAMPS shown in Figures 1 through 4 and inspect insulation.
- If insulation is broken or separated, tape with plastic electrical tape and reinstall CABLE CLAMP making sure that wire is properly positioned in CABLE CLAMP to prevent pinching.

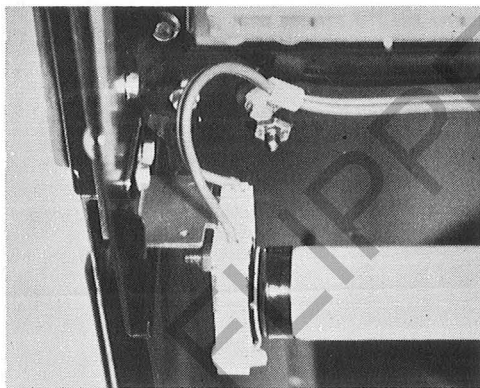


Figure 1. Upper Door Assembly - Left Hand

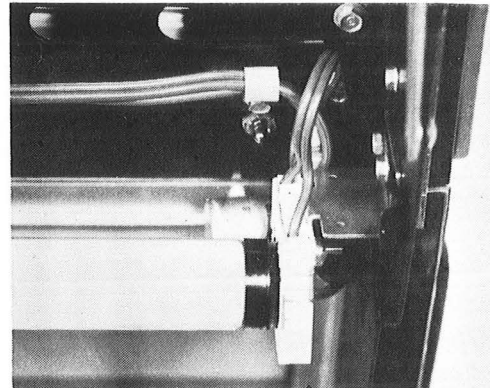


Figure 2. Upper Door Assembly - Right Hand

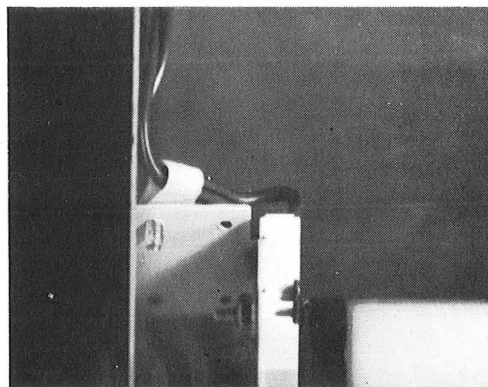


Figure 3. Service Door Assembly - Left Hand

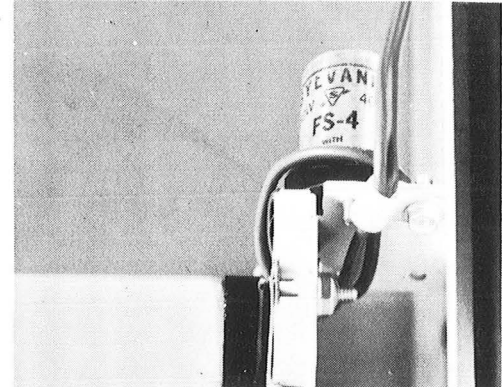


Figure 4. Service Door Assembly - Right Hand

Phonographs shipped from the factory after the Serial Numbers stated under SUBJECT will have this condition corrected.