



WURLITZER SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Supplemental Adjustment Procedure - Record Arm Shaft Coupling.

AFFECTING: Model 3400 Series Phonographs.

PURPOSE: In the event it becomes necessary to loosen the Record Arm Shaft Coupling Set Screws, the following procedure should be employed to insure proper timing of the record takeout operation.

ADJUSTMENT: The Record Changer must be in the rest position.

Loosen the two Coupling Set Screws illustrated in figure 1.

Select any selection. Momentarily position the scan-load-run switch to load as the tone arm swings to play position (the Record Arm will remain in the Record Magazine with the Coupling Set Screws loose).

Turn the service switch off to stop the Main Gear and Cam when the Lobe is $3/4$ " from the end of the Transfer Switch Actuator as illustrated in figure 2.

Tighten the two Coupling Set Screws illustrated in figure 1.

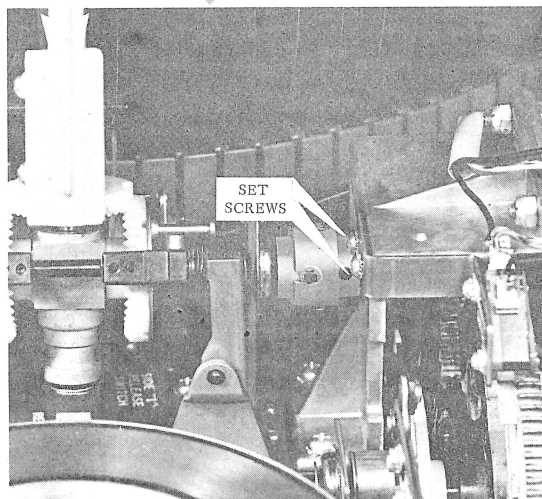


FIG. 1

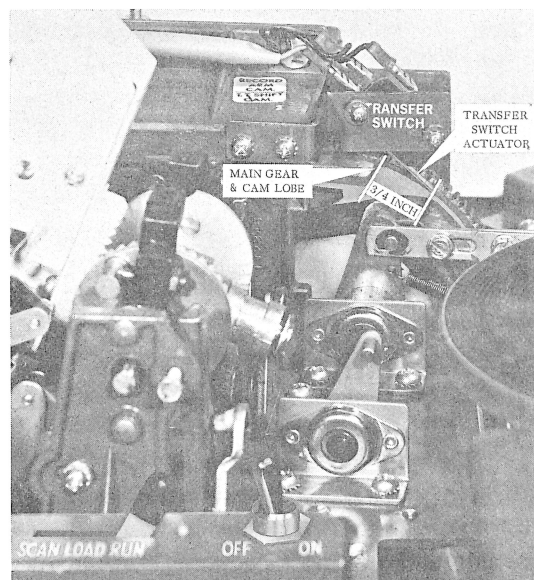


FIG. 2

FLIPPERS.COM